



# GX-6000 PID List Loader Instructions


1. Be sure the GX-6000PID program is installed on your computer.
2. Plug your IrDA cable into your computer.
3. Run the GX-6000PID program.
4. If a password window appears, type in 1994.
5. The main window appears.

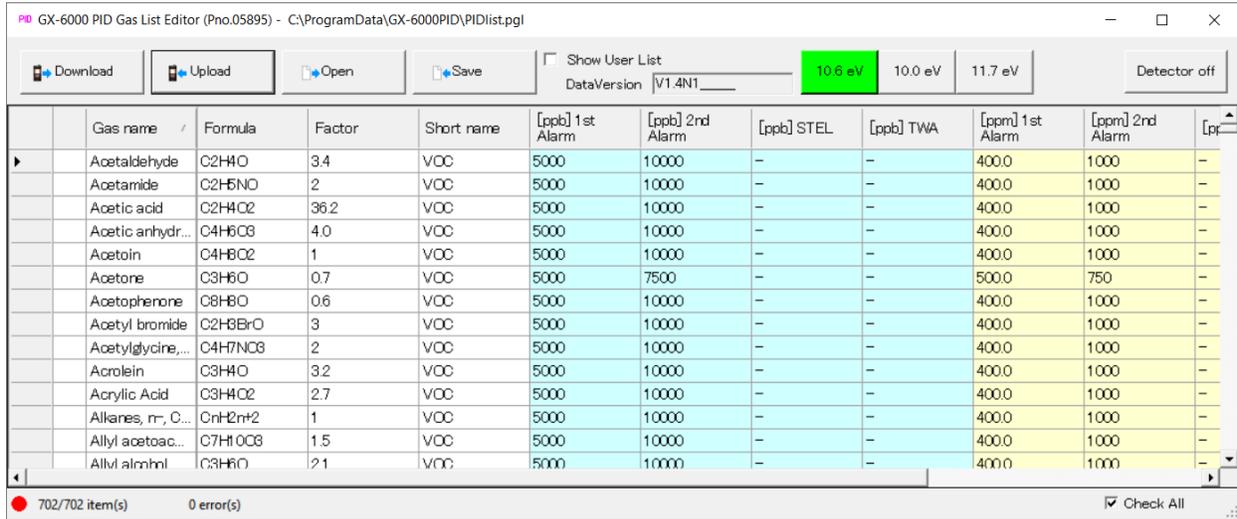


6. There are separate gas lists for the low/high range 10.6 eV sensors, the 10.0 eV/benzene sensor, and the 11.7 eV sensor.
7. Be sure the appropriate sensor is selected for the list you want to load. RKI Instruments, Inc. recommends that you load all 3 PID lists.
8. Line up the GX-6000's infrared port with the IrDA cable.
9. Turn on the GX-6000.
10. When the GX-6000 is connected, the GX-6000's screen will say "PC TRANSMIT".
11. With the correct sensor list displayed, click the **Upload** button.

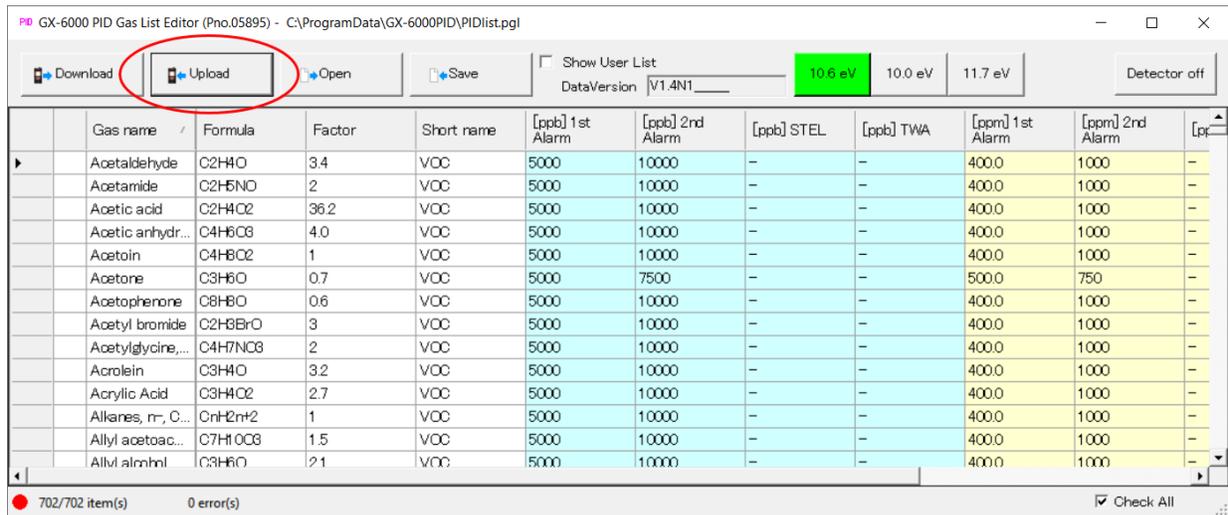

12. The upload will take approximately 3 minutes.

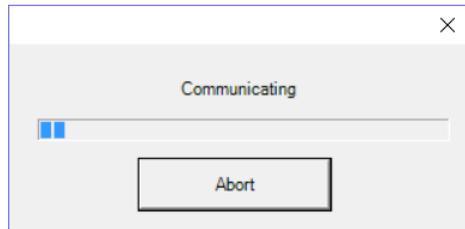

13. A window will pop up indicating that the upload is complete. Click OK.

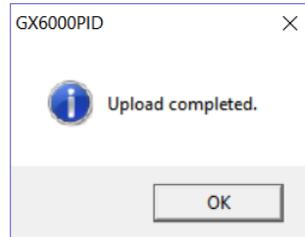

14. If you need to load another list, go back to step 6. When changing between gas lists, you will be asked if you want to save the current gas list. Click **No**.

15. Click the **Detector off** button to turn off the GX-6000.

16. Close the GX-6000PID program by clicking the X in the upper right corner.

17. You will be asked if you want to save the gas list. Click No.

